Art.-Nr: GAXD009ML
Exit sign Centralised power supply systems Surface mounting, Central power supply (ML), CPS, 30 m, IP40, Polycarbonate, White, Set of pictograms



Emergency exit sign luminaire with plastic pane for surface mounting on the ceiling and for identifying emergency and escape routes. It is based on the design of the A series luminaire family, which provides solutions for any mounting and has won the German Design Award for its uniform, straight-line design. The luminaires are equipped with modern LED illuminants and provide flexibility through their interchangeable pictograms.

Control and monitoring via central power supply system. Display edge luminaire with integrated light distribution for even pictogram illumination. Suited to inscription on one or two sides. Planning certainty is provided by tool-free, variable use of the pictograms on site. A set of pictograms corresponding to DIN ISO 7010 (arrow to the right, left, up and down) is supplied as standard.

CE


More information
www.rp-group.com/en/item/GAXD009ML

TECHNICAL DATA

Luminaire type	Exit sign
Mounting	Surface mounting
Recognition distance	30 m
Pictograph	Set
Illuminant	LED
Housing material	Polycarbonate
Housing color	White
Protection type (IP)	IP40
Impact resistance (IK)	5
Certification	CE, Waste disposal
Insulation class	2
Supply	Centralised power supply systems
Monitoring	Central power supply (ML)
Bridging time	CPS
Battery	/
Operating mode	single luminaire switching

Input voltage AC	230 V
Input frequency	50 / 60 Hz
Input voltage DC	216 V
Power max.	4,5 W
Power maintained	4,5 W
Power non-maintained	1,1 W
Ambient temperature maintained mode	-15 °C to 40 °C
Ambient temperature non-maintained mode	-5 °C to 55 °C
Depth	80.9 mm
Width	317.5 mm
Height	233.5 mm
Weight	0.88
Weight incl. packaging	1.37
Connection cross-section	2.5 mm²
Switching input	Yes
Emergency light blocking	No
Battery connection	No
Dimming function	Yes
Customs tariff number	94056120
GTIN	4260766550997

TECHNICAL DRAWING

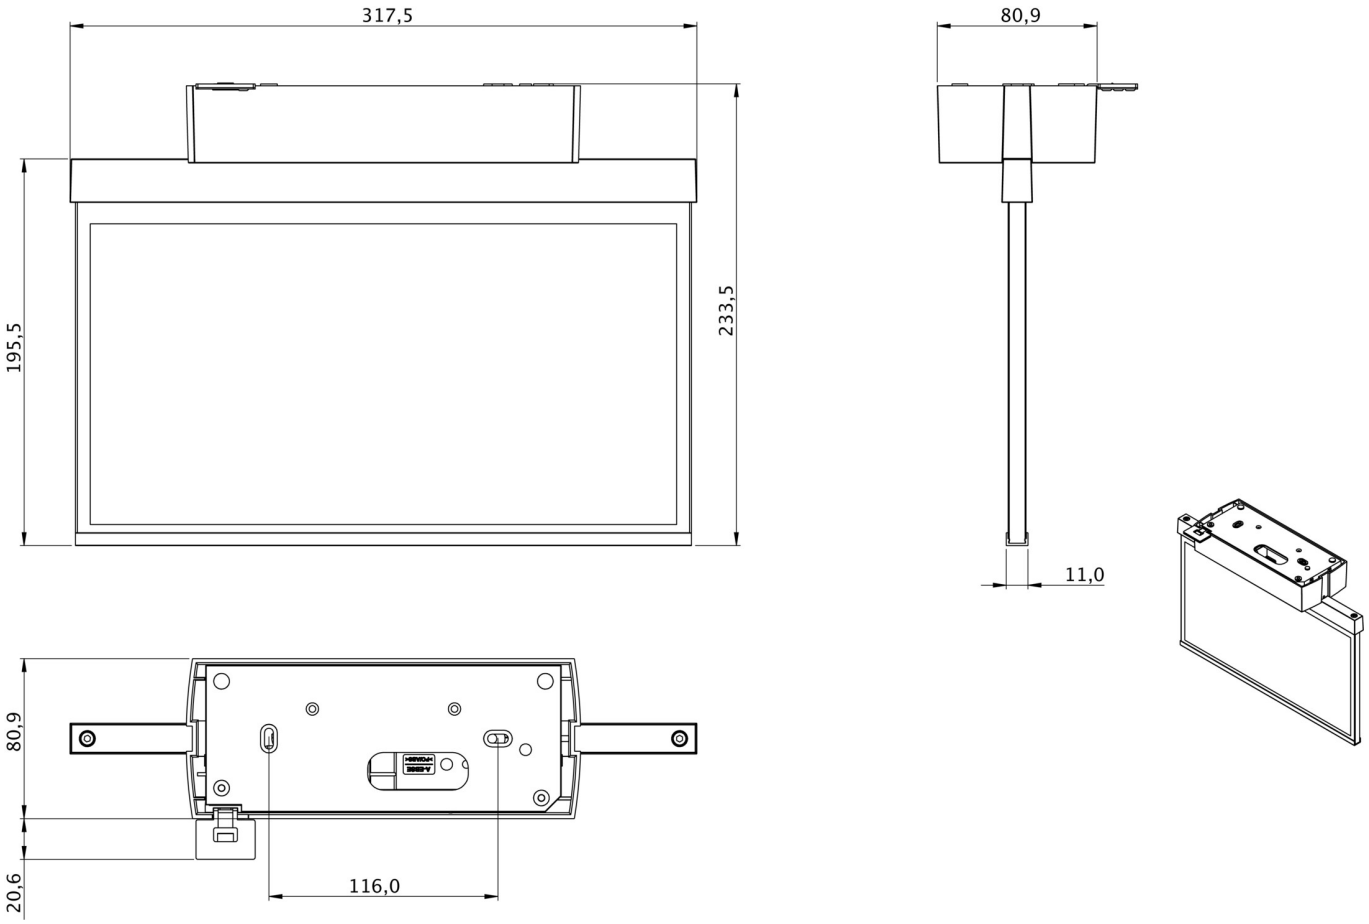

As of: 15.11.2026 - Subject to technical changes and errors.