Art.-Nr: AMR408SC
Exit sign Self-contained
Recessed wall mounting, SelfControl (SC), 8 h, 22 m, IP40, Zinc die-cast, White, Set of pictograms



Modern zinc die-cast emergency exit sign luminaire for recessed mounting in the wall and for identifying emergency and escape routes.

It is part of the A series luminaire family, which provides solutions for any mounting and has won the German Design Award for its uniform, straight-line design.

Automatic monitoring of safety luminaire with SelfControl. Planning certainty is provided by tool-free, variable use of the pictograms on site. A set of pictograms corresponding to DIN ISO 7010 (arrow to the right, left, up and down) is supplied as standard.

More information
www.rp-group.com/en/item/AMR408SC

TECHNICAL DATA


Luminaire type	Exit sign
Mounting	Recessed wall mounting
Recognition distance	22 m
Pictograph	Set
Illuminant	LED
Housing material	Zinc die-cast
Housing color	White
Protection type (IP)	IP40
Impact resistance (IK)	≥ 3
Certification	Waste disposal, CE, 5 Years waranty
Insulation class	2
Supply	Self-contained
Monitoring	SelfControl (SC)
Bridging time	8 h
Battery	LiFePO4 3,2 V/1,2 Ah
Operating mode	Non-maintained / maintained
Input voltage AC	230 V - 240 V



RP GROUP
SOLUTIONS IN SAFETY + LIGHTING

Input frequency	50 Hz
Power max.	2,6 W
Power maintained	1,7 W
Power non-maintained	0,9 W
Ambient temperature maintained mode	-5 °C to 40 °C
Ambient temperature non-maintained mode	-5 °C to 40 °C
Depth	79 mm
Width	236 mm
Height	151 mm
Installation length	176 mm
Installation width	68 mm
Installation height	40 mm
Weight	1.06
Weight incl. packaging	1.42
Connection cross-section	2,5 mm²
Switching input	Yes
Emergency light blocking	No
Battery connection	Connector
Dimming function	No
Luminous flux mains	50 lm
Luminous flux emergency	50 lm
Customs tariff number	94056180
GTIN	4262483022009

TECHNICAL DRAWING

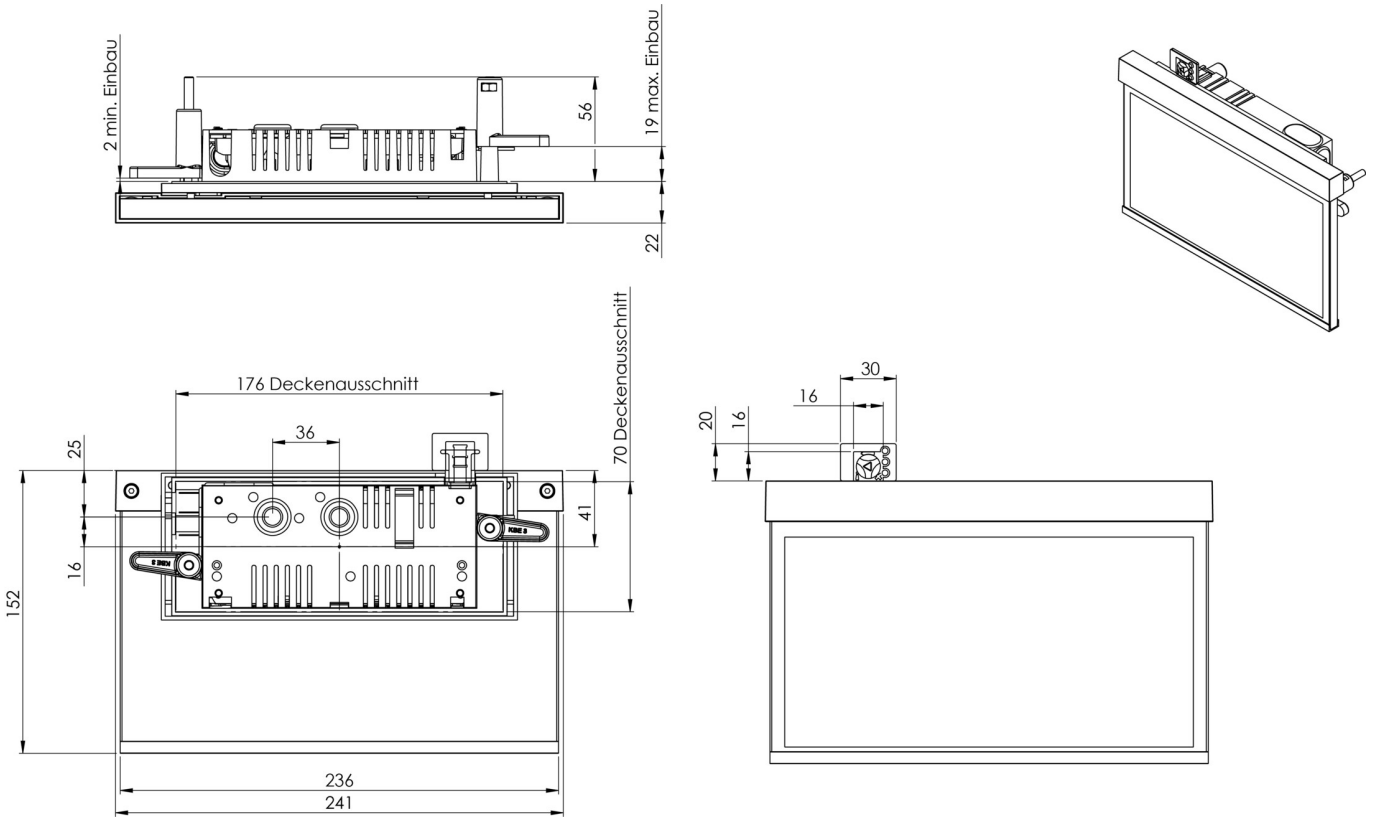

ACCESSORY LIST

BALLPLX-AM - Ball impact-resistant protective cover (PMMA) transparent for lights - AMW

AM-XBE - Flush-mounted box

As of: 22.11.2026 - Subject to technical changes and errors.