RP GROUP
SOLUTIONS IN SAFETY + LIGHTING

Art.-Nr: KWIW411SC-TT
Exit sign, Emergency light Self-contained Wall mounting, SelfControl (SC), 1 h, 16 m, IP65, Polycarbonate, White, Set of pictograms



Classic, robust, plastic, beam-like emergency exit sign luminaire with a high level of protection and self-adhesive pictogram for versatile use.

Intended for wall mounting when used as an emergency exit sign luminaire. Without the use of pictograms, it can be used as a safety luminaire, preferably for ceiling mounting.

Automatic monitoring of safety luminaire with SelfControl. Planning certainty is provided by tool-free, variable use of the pictograms on site. A set of pictograms corresponding to DIN ISO 7010 (arrow to the right, left, up and down) is supplied as standard.

CE D

More information
www.rp-group.com/en/item/KWIW411SC-TT

TECHNICAL DATA


Luminaire type	Exit sign, Emergency light
Mounting	Wall mounting
Recognition distance	16 m
Pictograph	Set
Illuminant	LED
Housing material	Polycarbonate
Housing color	White
Protection type (IP)	IP65
Impact resistance (IK)	6
Certification	CE, Waste disposal, D-sign
Insulation class	2
Supply	Self-contained
Monitoring	SelfControl (SC)
Bridging time	1 h
Battery	LiFePO4 3,2 V/3,3 Ah
Operating mode	Non-maintained / maintained
Input voltage AC	180 V - 250 V



RP GROUP
SOLUTIONS IN SAFETY + LIGHTING

Input frequency	50 Hz
Power max.	6,9 W
Power maintained	5,7 W
Power non-maintained	2 W
Ambient temperature maintained mode	-15 °C to 35 °C
Ambient temperature non-maintained mode	-15 °C to 35 °C
Depth	86 mm
Width	390 mm
Height	99 mm
Weight	0.76
Weight incl. packaging	0.86
Connection cross-section	2,5 mm²
Switching input	Yes
Emergency light blocking	No
Battery connection	Connector
Dimming function	No
Luminous flux mains	320 lm
Luminous flux emergency	320 lm
EOF	1
Customs tariff number	94056120
GTIN	4262484986492

TECHNICAL DRAWING

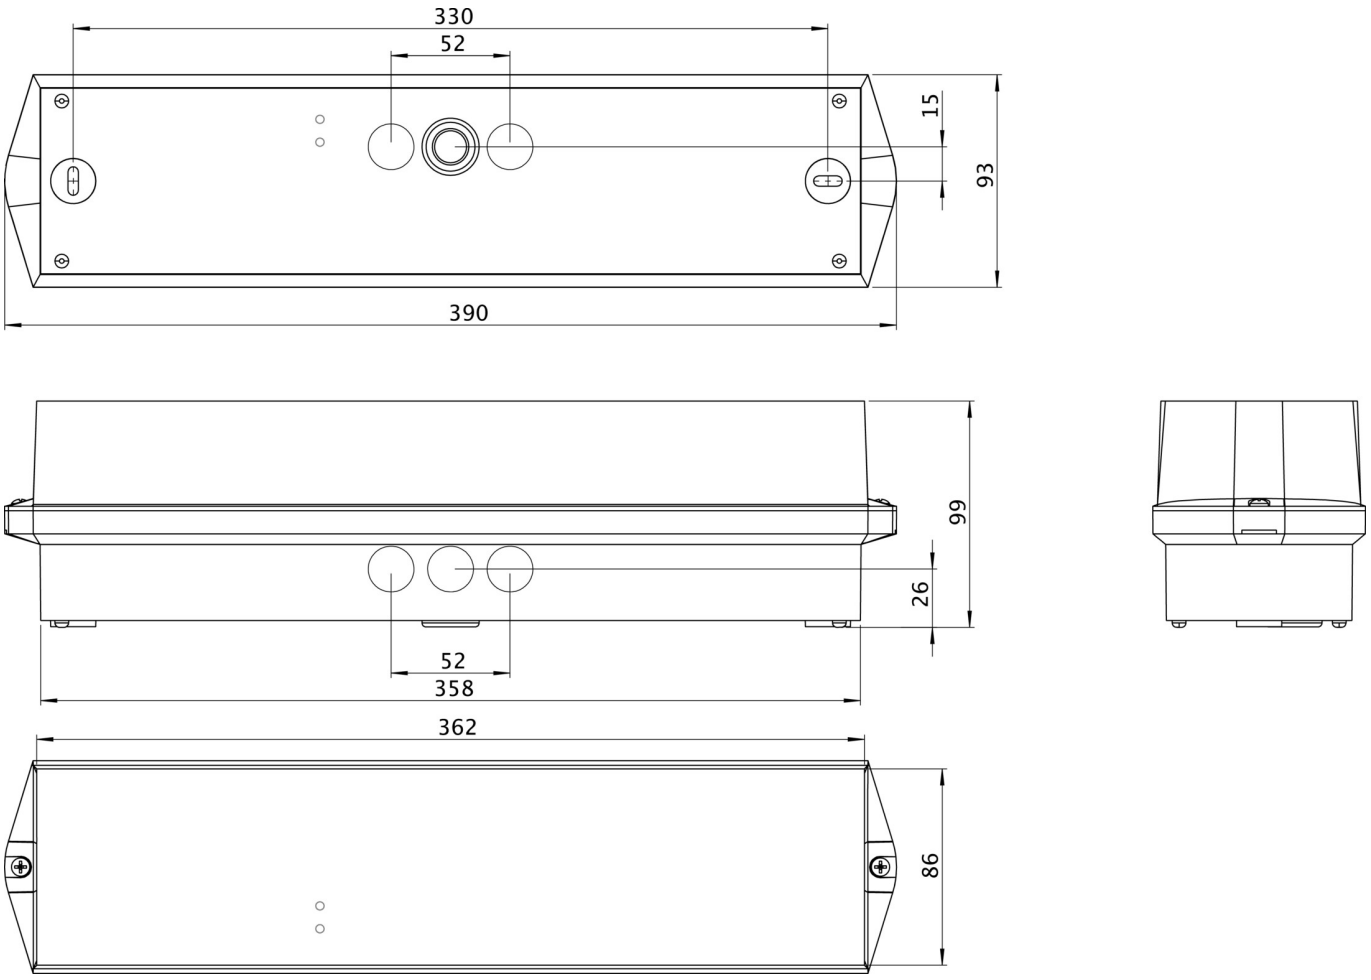

ACCESSORY LIST

BKW - Robust steel protective grille for emergency lighting

KWIE - Installation frame

As of: 13.10.2026 - Subject to technical changes and errors.