Art.-Nr: PFW418SC-P-TT
Exit sign Self-contained
Wall mounting, SelfControl (SC), 8 h, 24 m, IP65, Polycarbonate, White

Robust plastic emergency exit sign or safety luminaire.

Use as an emergency exit sign luminaire for wall mounting.

Or without the use of pictograms as a safety luminaire with the prismatic cover included, preferably for ceiling mounting.

Automatic monitoring of safety luminaire with SelfControl. Planning certainty is provided by tool-free, variable use of the pictograms on site. A set of pictograms corresponding to DIN ISO 7010 (arrow to the right, left and down) is supplied as standard. The designation "TT" stands for low-temperature batteries. These special lithium iron phosphate batteries are designed to function reliably even at low temperatures. They offer stable performance and a long lifespan, even under demanding conditions.

CE

JAHRE 5 YEARS
GARANTIE
WARRANTY

More information
www.rp-group.com/en/item/PFW418SC-P-TT

TECHNICAL DATA

Luminaire type	Exit sign
Mounting	Wall mounting
Recognition distance	24 m
Pictograph	Set
Illuminant	LED
Housing material	Polycarbonate
Housing color	White
Protection type (IP)	IP65
Impact resistance (IK)	5
Certification	WEEE, CE, 5 years warranty
Insulation class	1
Supply	Self-contained
Monitoring	SelfControl (SC)
Bridging time	8 h
Battery	LiFePO4 3,2 V/3,3 Ah
Operating mode	Non-maintained / maintained

Input voltage AC	180 V - 250 V
Input frequency	50 Hz
Power max.	5 W
Power maintained	3,8 W
Power non-maintained	2 W
Ambient temperature maintained mode	-15 °C to 40 °C
Ambient temperature non-maintained mode	-15 °C to 40 °C
Depth	150 mm
Width	365 mm
Height	110 mm
Weight	1.03
Weight incl. packaging	1.16
Connection cross-section	2,5 mm²
Switching input	Yes
Emergency light blocking	No
Battery connection	Connector
Dimming function	No
Luminous flux mains	150 lm
Luminous flux emergency	150 lm
Customs tariff number	94056120
GTIN	4262483023051

TECHNICAL DRAWING

370

152

105

370

152

105
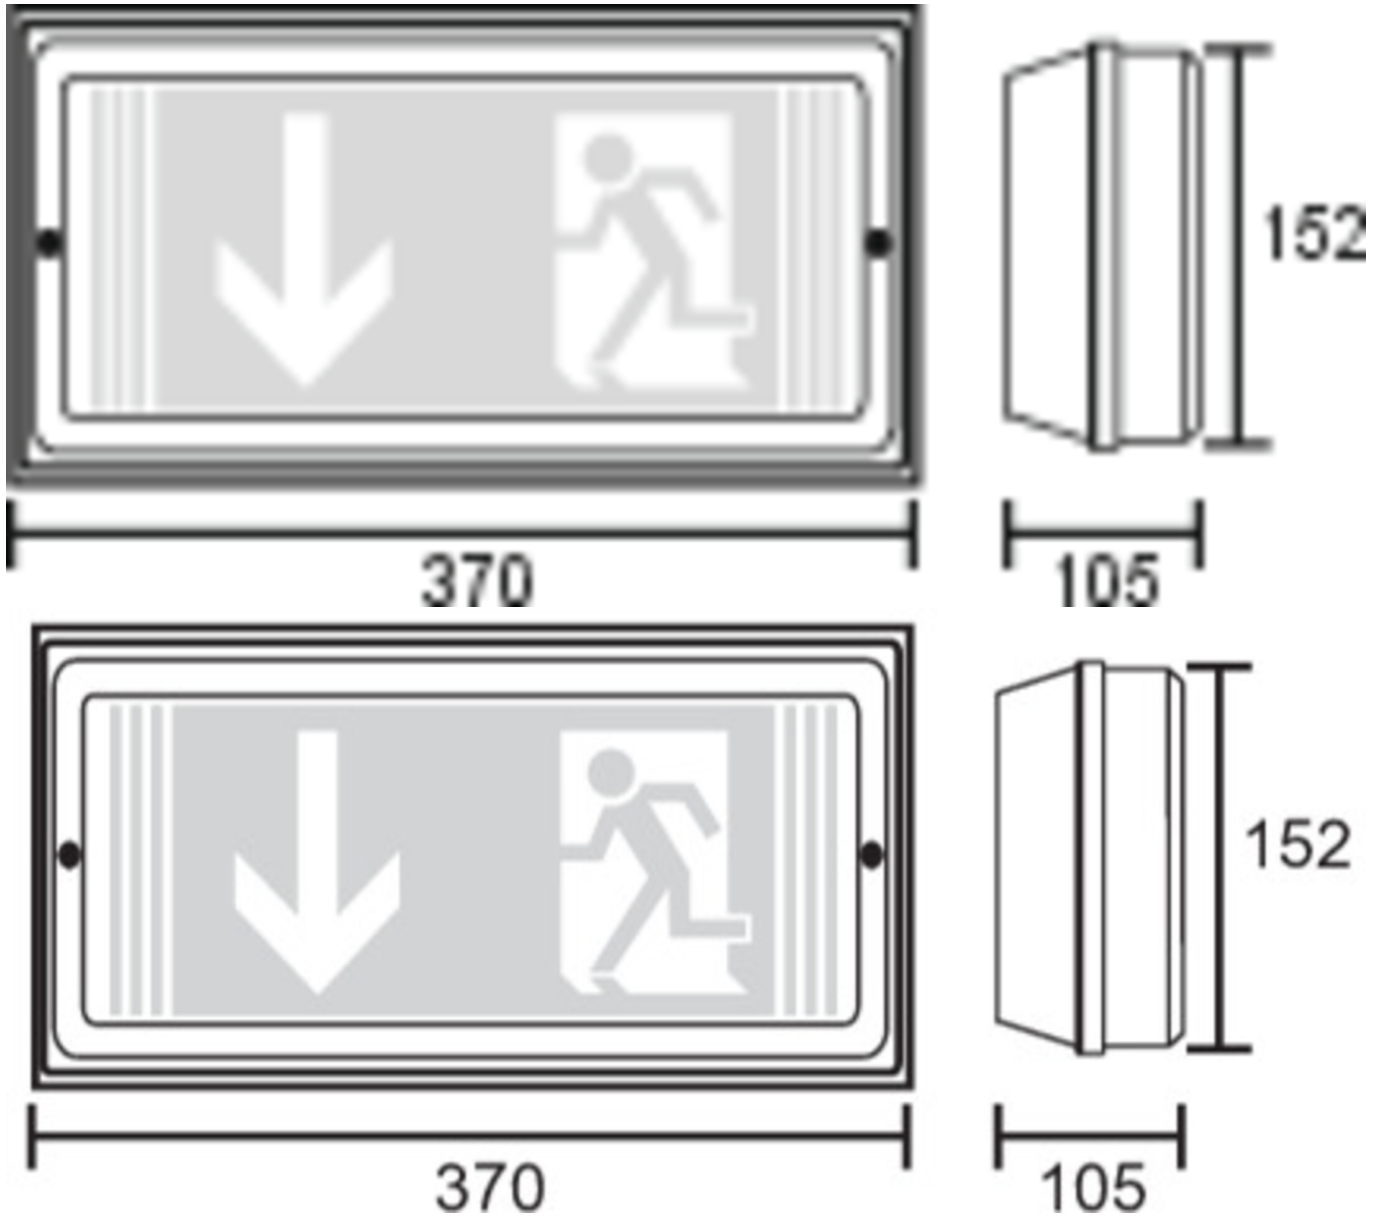
ACCESSORY LIST

BALL2 - Wire mesh guard

As of: 14.12.2025 - Subject to technical changes and errors.